

BAYERISCHE MOTOREN WERKE
AKTIENGESELLSCHAFT

Rundschreiben der Abteilung Kundendienst

Motorcycles: Group Engine No. 3/62 (191) e.

Munich, July 26, 1962
KV2 ke/ho/wi/lS

BMW R 27
Remedy for spitting Bing carburetors

Please note that henceforth the motorcycle R 27 is equipped with the improved

Bing carburetor 00 39 024.

On complaints about a spitting of the hitherto installed carburetor 00 39 015 this should be replaced with the new carburetor.

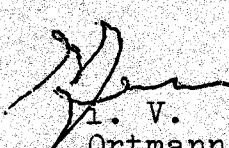
At the same time the rubber sleeve 00 42 160 to filter box should be provided with a 2 mm \emptyset (.08") drip hole, and then reinstalled in a way that this drip hole points vertically downward.

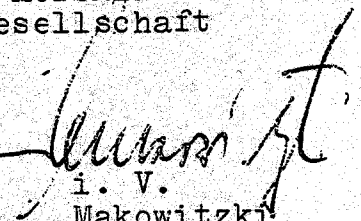
On justified complaints presented within the terms of the warranty send the removed carburetor together with a warranty claim showing frame and engine numbers to our department KV21 who will then issue a note of credit in a suchlike case.

In all other cases the costs für carburetor replacement are chargeable to the customer.

Yours very truly,

BAYERISCHE MOTOREN WERKE
Aktiengesellschaft


i. V.
Ortmann


i. V.
Makowitzki