

SERVICE INFORMATION

Cust.Serv.-Techn.Dept.
VKT er/wi/lü

Two-cylinder motorcycles
Gr.: Brakes, Wheels, Tires

München, 4-8-196-
Nr. 1/64 (210) er.

Re: Sealing of the wheel bearings

Dear Sirs,

commencing with frame number

636 591	(R 50)
626 063	(R 60)
658 624	(R 69 S)

a new sealing on the wheel hub outside has become standard equipment.

The service life of the wheel bearings will be considerably increased by this measure.

Per wheel, the following parts have been modified:

<u>Description of parts</u>	<u>Part No.</u>
1 cover screw for wheel hub	40 38 272
1 thrust bushing, left	40 38 243
1 radial shaft sealing ring	40 38 230

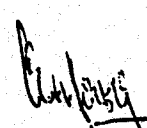
Superseded parts used hitherto:

1 cover screw for wheel hub	40 38 271
1 thrust bushing, left	40 38 242
1 felt ring	40 38 259
1 felt ring retainer	40 38 255
1 washer	40 38 267

In repair cases, the old sealing may be exchanged against the new one.

With friendly greetings
BAYERISCHE MOTOREN WERKE
Aktiengesellschaft


i.V. Ortmann


i.A. Ansorg